

## Section 1 – Survey Details [◀ Back](#)

### Address of Survey

UPRN:  
Address & Postcode: Chapel End School , ,  
, WN5 7TX

### Client Details

Client Name: STHMBC  
Address & Postcode: 5th Floor Wesley House, Corporation Street,  
, WA10 1HF

### Name and Address of Organisation

Name: The Testing Lab PLC  
Address & Postcode: Unit 2 James Road, Adwick-le-Street,  
Doncaster, DN6 7HH  
Telephone Number: 08001 777264  
Email: [info@thetestinglab.eu](mailto:info@thetestinglab.eu)  
Website: [www.thetestinglab.eu](http://www.thetestinglab.eu)  
UKAS Reference Number: 7758


### Survey Information

TTL Job No: J209920  
Date of Survey: 16/08/2022  
Date of Report: 26/08/2022

### Document Authorisation



Ian Greenan  
Lead Surveyor

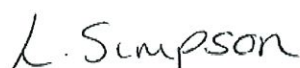

Louise Simpson  
Quality Checked

## Section 2 – Executive Summary [◀ Back](#)

### Scope, Type and Extent of Survey

The scope of this survey was to attend site and carry out a Management Asbestos Survey to the property known as Chapel End School. Care MUST be taken to read the site-specific information in Section 3. The area was temporarily vacant whilst the survey was undertaken. During the inspection, information was to be collated and recorded about the location and condition of asbestos containing materials and this information was to be used to carry out a risk assessment for each individual occurrence. The results of the risk assessments will be used to compile the asbestos management plan. This report relates ONLY to the specific building depicted on the front cover and should not be reproduced without the permission of the producer.

Please note that material risk assessments (MRA) are collected as standard; priority risk assessments (PRA) are collected at the clients request and are not covered within the scope of TTL's UKAS accreditation.

Should any suspect material be uncovered after this report has been issued, The Testing Lab PLC MUST be contacted in the first instance and shown the material in situ, to verify the said materials prior to any subsequent remedial action. No liability will be accepted for remedial works which have not been verified by The Testing Lab PLC.

### Site Specific Location & Summary of ACMs and Risk Scores

Below is a summary chart showing the locations of all of the components which have been identified as an asbestos containing material. ACMs with high scores are highlighted in red. For the individual material assessments, please refer to Section 5 – Pictures and Risk Scores of Individual Occurrences. For drawings depicting the exact location of the inspected component please see Section 5 – Marked-Up Plans.

Summary of ACMs [Back](#)

Record ID	As	Survey Type	Location	Product Type	Qty	Accessibility	Condition	Surface Treatment	Asbestos Type	Means of Identification	Material Risk	Priority	Action
<a href="#">S001</a>		Management	Main, Ground, 001 Main Entrance Lobby, Ceiling, Textured Coating To Ceiling	Textured Coating	8 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
<a href="#">S004</a>	(S001)	Management	Main, Ground, 002 & 003 School Office, Ceiling, Textured Coating To Ceiling	Textured Coating	16 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
<a href="#">S006</a>	(S001)	Management	Main, Ground, 004 Corridor, Ceiling, Textured Coating To Ceiling	Textured Coating	20 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
<a href="#">S009</a>		Management	Main, Ground, 004 Corridor , Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	20 Sqr Mtrs	Difficult	Good condition: no visible damage.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	2 (VL)	N/A	Manage
<a href="#">S010</a>		Management	Main, Ground, 006 Switch Room 1, Ceiling,	Textured Coating	4 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage



			Textured Coating To Ceiling										
►S012	(S009)	Management	Main, Ground, 006 Switch Room 1, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	4 Sqr Mtrs	Easy	Good condition: no visible damage.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	2 (VL)	N/A	Manage
►S014	(S010)	Management	Main, Ground, 005 Infants Hall, Ceiling, Textured Coating To Ceiling	Textured Coating	120 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S016		Management	Main, Ground, 005 Infants Hall, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	110 Sqr Mtrs	Easy	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
►S017	(S010)	Management	Main, Ground, 009 PE Store, Ceiling, Textured Coating To Ceiling	Textured Coating	10 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S019	(S016)	Management	Main, Ground, 009 PE Store, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	10 Sqr Mtrs	Easy	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S020		Management	Main, Ground, 010 Resource Area, Ceiling,	Textured Coating	300 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage

			Textured Coating To Ceiling					tiles, semi rigid paints or decorative finishes.					
►S022	(S009)	Management	Main, Ground, 010 Resource Area, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	300 Sqr Mtrs	Difficult	Good condition: no visible damage.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	2 (VL)	N/A	Manage
►S024	(S020)	Management	Main, Ground, 010A Art Store, Ceiling, Textured Coating To Ceiling	Textured Coating	3 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S026		Management	Main, Ground, 010A Art Store, Below Floor Covering, Floor Tile Adhesive Only	Bitumen Product	3 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
►S027	(S020)	Management	Main, Ground, 011 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	40 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S029	(S026)	Management	Main, Ground, 011 Classroom, Below Floor Covering, Floor Tile Adhesive Only	Bitumen Product	40 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage



►S030	(S020)	Management	Main, Ground, 012 Cleaners Cupboard, Ceiling, Textured Coating To Ceiling	Textured Coating	2 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S032	(S009)	Management	Main, Ground, 012 Cleaners Cupboard, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	2 Sqr Mtrs	Easy	Good condition: no visible damage.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	2 (VL)	N/A	Manage
►S033	(S020)	Management	Main, Ground, 013 Girls Toilets, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S037	(S020)	Management	Main, Ground, 014 Cloaks, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S040	(S020)	Management	Main, Ground, 015 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S044	(S020)	Management	Main, Ground, 017 Boys Toilets, Ceiling,	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage

			Textured Coating To Ceiling					tiles, semi rigid paints or decorative finishes.					
►S048	(S020)	Management	Main, Ground, 018 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S051	(S020)	Management	Main, Ground, 019 Cloaks, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S054	(S020)	Management	Main, Ground, 020 Girls Toilets, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S058	(S020)	Management	Main, Ground, 021 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S060	(S020)	Management	Main, Ground, 022 Boys Toilets, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage



►S063	(S020)	Management	Main, Ground, 023 Cloaks, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S066	(S020)	Management	Main, Ground, 024 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S070	(S020)	Management	Main, Ground, 027 Girls Toilets, Ceiling, Textured Coating To Ceiling	Textured Coating	6 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S074	(S020)	Management	Main, Ground, 028 Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S079	(S001)	Management	Main, Ground, 030 Head Teachers Office, Ceiling, Textured Coating To Ceiling	Textured Coating	16 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S081	(S026)	Management	Main, Ground,	Bitumen Product	16 Sqr Mtrs	Difficult	Low damage: a few scratches or surface	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage



			030 Head Teachers Office, Below Floor Covering, Floor Tile Adhesive Only				marks, broken edges on boards, tiles etc.	tiles, semi rigid paints or decorative finishes.					
►S082	(S001)	Management	Main, Ground, 031 Staff Room, Ceiling, Textured Coating To Ceiling	Textured Coating	50 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S092	(S009)	Management	Main, Ground, 033 Store Room, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	4 Sqr Mtrs	Easy	Good condition: no visible damage.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	2 (VL)	N/A	Manage
►S095		Management	Main, Ground, 034 First Aid Room, Cistern & Seat, Cistern & Seat	Plastic	1 Num	Easy	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Amosite	The Testing Lab PLC	4 (VL)	N/A	Manage
►S099	(S001)	Management	Main, Ground, 076 Reprographics, Ceiling, Textured Coating To Ceiling	Textured Coating	16 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S107		Management	Main, Ground, 075 PE Store, Floor, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	16 Sqr Mtrs	Easy	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage

►S110		Management	Main, Ground, 037 Servery / Chair Store, Sink Pad, Sink Pad	Bitumen Product	1 Num	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
►S116		Management	Main, Ground, 038 Kitchen , Table, Bitumen Paint	Bitumen Product	2 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
►S146		Management	Main, Ground, 055 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage
►S152	(S146)	Management	Main, Ground, 057 & 058 Classroom Store, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S155	(S146)	Management	Main, Ground, 059 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S158	(S146)	Management	Main, Ground, 060 Classroom Store, Below Floor Covering,	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage



			Floor Tiles & Adhesive										
►S178	(S146)	Management	Main, Ground, 068 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S181	(S146)	Management	Main, Ground, 069 Classroom Store, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S184	(S146)	Management	Main, Ground, 070 Classroom Store, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S187	(S146)	Management	Main, Ground, 071 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S204		Management	Main, Ground, N001 Cloakroom, Ceiling, Textured Coating To Ceiling	Textured Coating	10 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage

►S207	(S204)	Management	Main, Ground, N001A Disabled Toilet, Ceiling, Textured Coating To Ceiling	Textured Coating	7 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S210	(S204)	Management	Main, Ground, N002 Nursery Classroom, Ceiling, Textured Coating To Ceiling	Textured Coating	30 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S217	(S204)	Management	Main, Ground, N007 Laundry, Ceiling, Textured Coating To Ceiling	Textured Coating	7 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S220	(S204)	Management	Main, Ground, N007A Laundry Store, Ceiling, Textured Coating To Ceiling	Textured Coating	1 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S239		Management	Main, First, 106 Classroom Store, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Chrysotile	The Testing Lab PLC	3 (VL)	N/A	Manage



►S242	(S239)	Management	Main, First, 107 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S245	(S239)	Management	Main, First, 108 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S271	(S239)	Management	Main, First, 119 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S275	(S239)	Management	Main, First, 121 Classroom, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	60 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S278	(S239)	Management	Main, First, 122 Classroom Store, Below Floor Covering, Floor Tiles & Adhesive	Thermo Plastic Floor Tiles	1 Sqr Mtrs	Difficult	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
►S285		Management	Main, Ground,	Textured Coating	2 Sqr Mtrs	Medium	Medium damage: significant breakage or materials or several small areas where	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl	Chrysotile	The Testing Lab PLC	4 (VL)	N/A	Encapsulate/Repair

			007 Gas Meter Cupboard , Ceiling, Textured Coating To Ceiling				material has been damaged revealing loose asbestos fibres.	tiles, semi rigid paints or decorative finishes.					
► S287	(S285)	Management	Main, Ground, 008 Boiler Room, Ceiling, Textured Coating To Ceiling	Textured Coating	20 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Composite materials containing asbestos: reinforced plastics, resins, mastics, vinyl tiles, semi rigid paints or decorative finishes.	Strongly Presumed Chrysotile	In-House Database	3 (VL)	N/A	Manage
► S295		Management	Main, Ground, 047 Main Switch Room , Cable Wrap, Cable Wrap	Textiles	1 Num	Medium	Good condition: no visible damage.	Enclosed sprays and lagging, AIB (with exposed face painted or encapsulated) asbestos cement sheets.	Strongly Presumed Crocidolite Amosite	In-House Database	6 (L)	N/A	Manage
► S297		Management	Main, Ground, 049 Boiler Room 2, Ceiling, Ceiling	Cement	15 Sqr Mtrs	Medium	Low damage: a few scratches or surface marks, broken edges on boards, tiles etc.	Enclosed sprays and lagging, AIB (with exposed face painted or encapsulated) asbestos cement sheets.	Chrysotile	The Testing Lab PLC	4 (VL)	N/A	Encapsulate and Label



Summary of Non-Suspect or NADIS Items [← Back](#)

The table below depicts items which were assessed but were either non-suspect or NADIS. Other components may have been looked at but are not listed due to the nature of the component and obvious common knowledge. If in doubt about a component please call The Testing Lab on 08001 777264.

Record ID	Survey Type	Location	Sample Ref	Qty	Action
<a href="#">▶ S003</a>	Management	Main, Ground, 001 Main Entrance Lobby, Walls & Floor, Walls & Floor		Num	No further action required
<a href="#">▶ S005</a>	Management	Main, Ground, 002 & 003 School Office, Walls & Floor, Walls & Floor		Num	No further action required
<a href="#">▶ S008</a>	Management	Main, Ground, 004 Corridor, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S011</a>	Management	Main, Ground, 006 Switch Room 1, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S013</a>	Management	Main, Ground, 006 Switch Room 1, Electrics, Electrics		Num	No further action required
<a href="#">▶ S015</a>	Management	Main, Ground, 005 Infants Hall, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S018</a>	Management	Main, Ground, 009 PE Store, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S021</a>	Management	Main, Ground, 010 Resource Area, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S023</a>	Management	Main, Ground, 010 Resource Area, Electrics, Electrics		Num	No further action required
<a href="#">▶ S025</a>	Management	Main, Ground, 010A Art Store, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S028</a>	Management	Main, Ground, 011 Classroom, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S031</a>	Management	Main, Ground, 012 Cleaners Cupboard, Walls Internal, Walls Internal		Num	No further action required
<a href="#">▶ S034</a>	Management	Main, Ground, 013 Girls Toilets, Walls Internal, Walls Internal		Num	No further action required

►S036	Management	Main, Ground, 013 Girls Toilets, Toilet Seat, Toilet Seat	S036	3 Num	No Further Action Required
►S038	Management	Main, Ground, 014 Cloaks, Walls Internal, Walls Internal		Num	No further action required
►S041	Management	Main, Ground, 015 Classroom, Walls & Floor, Walls & Floor		Num	No further action required
►S043	Management	Main, Ground, 016 Covered Play Area, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
►S045	Management	Main, Ground, 017 Boys Toilets, Walls Internal, Walls Internal		Num	No further action required
►S047	Management	Main, Ground, 017 Boys Toilets, Toilet Seat, Toilet Seat	(As S036)	3 Num	No Further Action Required
►S049	Management	Main, Ground, 018 Classroom, Walls & Floor, Walls & Floor		Num	No further action required
►S052	Management	Main, Ground, 019 Cloaks, Walls Internal, Walls Internal		Num	No further action required
►S055	Management	Main, Ground, 020 Girls Toilets, Walls Internal, Walls Internal		Num	No further action required
►S057	Management	Main, Ground, 020 Girls Toilets, Toilet Seat, Toilet Seat	(As S036)	3 Num	No Further Action Required
►S059	Management	Main, Ground, 021 Classroom, Walls & Floor, Walls & Floor		Num	No further action required
►S061	Management	Main, Ground, 022 Boys Toilets, Walls Internal, Walls Internal		Num	No further action required
►S064	Management	Main, Ground, 023 Cloaks, Walls Internal, Walls Internal		Num	No further action required
►S067	Management	Main, Ground, 024 Classroom, Walls & Floor, Walls & Floor		Num	No further action required
►S069	Management	Main, Ground, 026 Covered Play Area, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
►S071	Management	Main, Ground, 027 Girls Toilets, Walls Internal, Walls Internal		Num	No further action required
►S073	Management	Main, Ground, 027 Girls Toilets, Toilet Seat, Toilet Seat	(As S036)	3 Num	No Further Action Required



► S075	Management	Main, Ground, 028 Classroom, Walls & Floor, Walls & Floor		Num	No further action required
► S077	Management	Main, Ground, 029 Female Toilets, Ceiling & Walls, Ceiling & Walls		Num	No further action required
► S080	Management	Main, Ground, 030 Head Teachers Office, Walls Internal, Walls Internal		Num	No further action required
► S083	Management	Main, Ground, 031 Staff Room, Walls & Floor, Walls & Floor		Num	No further action required
► S085	Management	Main, Ground, 031A Passage, Ceiling, Ceiling	S085	8 Sqr Mtrs	No Further Action Required
► S086	Management	Main, Ground, 031A Passage, Walls & Floor, Walls & Floor		Num	No further action required
► S087	Management	Main, Ground, 032 Site Managers Room, Ceiling, Ceiling	{As S085}	8 Sqr Mtrs	No Further Action Required
► S088	Management	Main, Ground, 032 Site Managers Room, Walls Internal, Walls Internal		Num	No further action required
► S090	Management	Main, Ground, 033 Store Room, Ceiling, Ceiling	{As S085}	4 Sqr Mtrs	No Further Action Required
► S091	Management	Main, Ground, 033 Store Room, Walls Internal, Walls Internal		Num	No further action required
► S093	Management	Main, Ground, 034 First Aid Room, Ceiling & Walls, Ceiling & Walls		Num	No further action required
► S096	Management	Main, Ground, 035 Wet Room, Ceiling, Ceiling	{As S085}	9 Sqr Mtrs	No Further Action Required
► S097	Management	Main, Ground, 035 Wet Room, Walls Internal, Walls Internal		Num	No further action required
► S100	Management	Main, Ground, 076 Reprographics , Walls Internal, Walls Internal		Num	No further action required
► S102	Management	Main, Ground, 036 Junior Hall, Ceiling, Ceiling	{As S085}	250 Sqr Mtrs	No Further Action Required
► S103	Management	Main, Ground, 036 Junior Hall, Walls & Floor, Walls & Floor		Num	No further action required

► S105	Management	Main, Ground, 075 PE Store, Ceiling, Ceiling	(As S085)	16 Sqr Mtrs	No Further Action Required
► S106	Management	Main, Ground, 075 PE Store, Walls internal, Walls internal		Num	No further action required
► S108	Management	Main, Ground, 037 Servery / Chair Store, Ceiling & Walls, Ceiling & Walls		Num	No further action required
► S111	Management	Main, Ground, 052 Wash Up Area, Ceiling, Textured Coating To Ceiling	S111	20 Sqr Mtrs	No Further Action Required
► S112	Management	Main, Ground, 052 Wah Up Area, Walls & Floor, Walls & Floor		Num	No further action required
► S113	Management	Main, Ground, 038 Kitchen, Ceiling, Textured Coating To Ceiling	(As S111)	60 Sqr Mtrs	No Further Action Required
► S114	Management	Main, Ground, 038 Kitchen , Walls & Floor, Walls & Floor		Num	No further action required
► S115	Management	Main, Ground, 038 Kitchen , Sink Pad, Sink Pad	S115	2 Num	No Further Action Required
► S118	Management	Main, Ground, 039 & 040 Fire Exit, Ceiling, Textured Coating To Ceiling	(As S111)	18 Sqr Mtrs	No Further Action Required
► S119	Management	Main, Ground, 039 & 040 Fire Exit, Walls & Floor, Walls & Floor		Num	No further action required
► S120	Management	Main, Ground, 039 & 040 Fire Exit, Consumer Unit, Consumer Unit		Num	No further action required
► S123	Management	Main, Ground, 041 Kitchen Office , Walls & Floor, Walls & Floor		Num	No further action required
► S124	Management	Main, Ground, 042 Cupboard, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S125	Management	Main, Ground, 044 Cleaners Cupboard, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S127	Management	Main, Ground, 045 Kitchen Toilet, Walls & Floor, Walls & Floor		Num	No further action required



► S128	Management	Main, Ground, 045 Kitchen Toilet, Toilet Seat, Toilet Seat	{As S036}	1 Num	No Further Action Required
► S130	Management	Main, Ground, 046 Changing Room, Walls & Floor, Walls & Floor		Num	No further action required
► S131	Management	Main, Ground, 048 Kitchen Store, Ceiling, Textured Coating To Ceiling	{As S111}	20 Sqr Mtrs	No Further Action Required
► S132	Management	Main, Ground, 048 Kitchen Store, Walls & Floor, Walls & Floor		Num	No further action required
► S133	Management	Main, Ground, 050 Small Kitchen, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S134	Management	Main, Ground, 051 Classroom, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S136	Management	Main, Ground, 051A Resource Room, Ceiling, Ceiling	{As S085}	4 Sqr Mtrs	No Further Action Required
► S137	Management	Main, Ground, 051A Resource Room, Walls & Floor, Walls & Floor		Num	No further action required
► S138	Management	Main, Ground, 053 Lobby 1, Ceiling, Ceiling	S138	18 Sqr Mtrs	No Further Action Required
► S139	Management	Main, Ground, 053 Lobby 1, Walls Internal, Walls Internal		Num	No further action required
► S141	Management	Main, Ground, 054 Resource Area, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
► S142	Management	Main, Ground, 054 Resource Area, Walls Internal, Walls Internal		Num	No further action required
► S144	Management	Main, Ground, 055 Classroom, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
► S145	Management	Main, Ground, 055 Classroom, Walls Internal, Walls Internal		Num	No further action required
► S147	Management	Main, Ground, 056 Girls Toilets, Ceiling, Ceiling	{As S138}	9 Sqr Mtrs	No Further Action Required
► S148	Management	Main, Ground, 056 Girls Toilets, Walls Internal, Walls Internal		Num	No further action required

►S150	Management	Main, Ground, 057 & 58 Classroom Store, Ceiling, Ceiling	{As S138}	1 Sqr Mtrs	No Further Action Required
►S151	Management	Main, Ground, 057 & 058 Classroom Store, Walls Internal, Walls Internal		Num	No further action required
►S153	Management	Main, Ground, 059 Classroom, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
►S154	Management	Main, Ground, 059 Classroom, Walls Internal, Walls Internal		Num	No further action required
►S156	Management	Main, Ground, 060 Classroom Store, Ceiling, Ceiling	{As S138}	1 Sqr Mtrs	No Further Action Required
►S157	Management	Main, Ground, 060 Classroom Store, Walls Internal, Walls Internal		Num	No further action required
►S159	Management	Main, Ground, 061 Cloaks, Ceiling, Ceiling	{As S138}	12 Sqr Mtrs	No Further Action Required
►S160	Management	Main, Ground, 061 Cloaks, Walls Internal, Walls Internal		Num	No further action required
►S162	Management	Main, Ground, 062 Boys Toilets, Ceiling, Ceiling	{As S138}	9 Sqr Mtrs	No Further Action Required
►S163	Management	Main, Ground, 062 Boys Toilets, Walls Internal, Walls Internal		Num	No further action required
►S165	Management	Main, Ground, 063 ICT Suite, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
►S166	Management	Main, Ground, 064 ICT Server Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
►S167	Management	Main, Ground, 065 Girls Toilets, Ceiling, Ceiling	{As S138}	9 Sqr Mtrs	No Further Action Required
►S168	Management	Main, Ground, 065 Girls Toilets, Walls Internal, Walls Internal		Num	No further action required
►S170	Management	Main, Ground, 066 Resource Area, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
►S171	Management	Main, Ground, 066 Resource Area, Walls Internal, Walls Internal		Num	No further action required



► S173	Management	Main, Ground, 067 Cloaks, Ceiling, Ceiling	{As S138}	12 Sqr Mtrs	No Further Action Required
► S174	Management	Main, Ground, 067 Cloaks, Walls Internal, Walls Internal		Num	No further action required
► S176	Management	Main, Ground, 068 Classroom, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
► S177	Management	Main, Ground, 068 Classroom, Walls Internal, Walls Internal		Num	No further action required
► S179	Management	Main, Ground, 069 Classroom Store, Ceiling, Ceiling	{As S138}	1 Sqr Mtrs	No Further Action Required
► S180	Management	Main, Ground, 069 Classroom Store, Walls Internal, Walls Internal		Num	No further action required
► S182	Management	Main, Ground, 070 Classroom Store, Ceiling, Ceiling	{As S138}	1 Sqr Mtrs	No Further Action Required
► S183	Management	Main, Ground, 070 Classroom Store, Walls Internal, Walls Internal		Num	No further action required
► S185	Management	Main, Ground, 071 Classroom, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
► S186	Management	Main, Ground, 071 Classroom, Walls Internal, Walls Internal		Num	No further action required
► S188	Management	Main, Ground, 072 Boys Toilets, Ceiling, Ceiling	{As S138}	9 Sqr Mtrs	No Further Action Required
► S189	Management	Main, Ground, 072 Boys Toilets, Walls Internal, Walls Internal		Num	No further action required
► S191	Management	Main, Ground, 073 & 074 Reading Area, Ceiling, Ceiling	{As S138}	60 Sqr Mtrs	No Further Action Required
► S192	Management	Main, Ground, 073 & 074 Reading Area, Walls & Floor, Walls & Floor		Num	No further action required
► S193	Management	Main, Ground, 077 & 088 Entrance Lobby, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S194	Management	Main, Ground, 078 Meeting Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required

▶S195	Management	Main, Ground, 069 Office, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S196	Management	Main, Ground, 080 Server Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S197	Management	Main, Ground, 081 Classroom, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S198	Management	Main, Ground, 082 Kitchen, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S199	Management	Main, Ground, 083 Toilets , Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S200	Management	Main, Ground, 084 Corridor / Cloaks, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S201	Management	Main, Ground, 085 Toilet, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S202	Management	Main, Ground, 086 Disabled Toilet, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S203	Management	Main, Ground, 087 Plant Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
▶S205	Management	Main, Ground, N001 Cloakroom, Walls Internal, Walls Internal		Num	No further action required
▶S208	Management	Main, Ground, N001A Disabled Toilet, Walls Internal, Walls Internal		Num	No further action required
▶S211	Management	Main, Ground, N002 Nursery Classroom, Walls & Floor, Walls & Floor		Num	No further action required
▶S213	Management	Main, Ground, N004 Toilets, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required



► S214	Management	Main, Ground, N005 Sand Pit, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S215	Management	Main, Ground, N006 Store Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S216	Management	Main, Ground, N006A Covered Play Area, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S218	Management	Main, Ground, N007 Laundry , Walls Internal, Walls Internal		Num	No further action required
► S221	Management	Main, Ground, N007A Laundry Store, Walls Internal, Walls Internal		Num	No further action required
► S223	Management	Main, First, 101 Stairwells, Ceiling, Ceiling	S223	6 Sqr Mtrs	No Further Action Required
► S224	Management	Main, First, 101 Stairwells, Walls & Floor, Walls & Floor		Num	No further action required
► S225	Management	Main, First, 102 Lobby / Cloaks, Ceiling, Ceiling	{As S223}	10 Sqr Mtrs	No Further Action Required
► S226	Management	Main, First, 102 Lobby / Cloaks, Walls Internal, Walls Internal		Num	No further action required
► S228	Management	Main, First, 103 Girls Toilets, Ceiling & Walls, Ceiling & Walls		Num	No further action required
► S230	Management	Main, First, 103 Girls Toilets, Toilet Seat, Toilet Seat	S230	3 Num	No Further Action Required
► S231	Management	Main, First, 104 Resource Area, Ceiling, Ceiling	{As S223}	60 Sqr Mtrs	No Further Action Required
► S232	Management	Main, First, 104 Resource Area, Walls Internal, Walls Internal		Num	No further action required
► S234	Management	Main, First, 105 Cleaners Store, Ceiling, Ceiling	{As S223}	1 Sqr Mtrs	No Further Action Required
► S235	Management	Main, First, 105 Cleaners Store, Walls Internal, Walls Internal		Num	No further action required
► S237	Management	Main, First, 106 Classroom Store, Ceiling, Ceiling	{As S223}	1 Sqr Mtrs	No Further Action Required
► S238	Management	Main, First, 106 Classroom Store, Walls Internal, Walls Internal		Num	No further action required

► S240	Management	Main, First, 107 Classroom, Ceiling, Ceiling	(As S223)	60 Sqr Mtrs	No Further Action Required
► S241	Management	Main, First, 107 Classroom, Walls Internal, Walls Internal		Num	No further action required
► S243	Management	Main, First, 108 Classroom, Ceiling, Ceiling	(As S223)	60 Sqr Mtrs	No Further Action Required
► S244	Management	Main, First, 108 Classroom, Walls Internal, Walls Internal		Num	No further action required
► S246	Management	Main, First, 109 Classroom Cupboards, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S247	Management	Main, First, 110 Cloaks, Ceiling, Ceiling	(As S223)	12 Sqr Mtrs	No Further Action Required
► S248	Management	Main, First, 110 Cloaks, Walls Internal, Walls Internal		Num	No further action required
► S250	Management	Main, First, 111 Boys Toilets, Ceiling & Walls, Ceiling & Walls		Num	No further action required
► S252	Management	Main, First, 111 Boys Toilets, Toilet Seat, Toilet Seat	(As S230)	1 Num	No Further Action Required
► S253	Management	Main, First, 112 & 113 Resource Area, Ceiling, Ceiling	(As S223)	60 Sqr Mtrs	No Further Action Required
► S254	Management	Main, First, 112 & 113 Resource Area , Walls Internal, Walls Internal		Num	No further action required
► S256	Management	Main, First, 114 Store, Ceiling, Ceiling	(As S223)	6 Sqr Mtrs	No Further Action Required
► S257	Management	Main, First, 114 Store, Walls & Floor, Walls & Floor		Num	No further action required
► S258	Management	Main, First, 115 Lobby / Cloaks, Ceiling, Ceiling	(As S223)	10 Sqr Mtrs	No Further Action Required
► S259	Management	Main, First, 115 Lobby / Cloaks, Walls Internal, Walls Internal		Num	No further action required
► S261	Management	Main, First, 116 Resource Area , Ceiling, Ceiling	(As S223)	60 Sqr Mtrs	No Further Action Required
► S262	Management	Main, First, 116 Resource Area, Walls Internal, Walls Internal		Num	No further action required

►S264	Management	Main, First, 117 Girls Toilets, Ceiling & Walls, Ceiling & Walls		Num	No further action required
►S266	Management	Main, First, 118 Cloaks, Ceiling, Ceiling	{As S223}	12 Sqr Mtrs	No Further Action Required
►S267	Management	Main, First, 118 Cloaks, Walls Internal, Walls Internal		Num	No further action required
►S269	Management	Main, First, 119 Classroom, Ceiling, Ceiling	{As S223}	60 Sqr Mtrs	No Further Action Required
►S270	Management	Main, First, 119 Classroom, Walls Internal, Walls Internal		Num	No further action required
►S272	Management	Main, First, 120 Classroom Cupboards, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
►S273	Management	Main, First, 121 Classroom , Ceiling, Ceiling	{As S223}	60 Sqr Mtrs	No Further Action Required
►S274	Management	Main, First, 121 Classroom, Walls Internal, Walls Internal		Num	No further action required
►S276	Management	Main, First, 122 Classroom Store, Ceiling, Ceiling	{As S223}	1 Sqr Mtrs	No Further Action Required
►S277	Management	Main, First, 122 Classroom Store, Walls Internal, Walls Internal		Num	No further action required
►S279	Management	Main, First, 123 Small Store, Ceiling, Ceiling	{As S223}	1 Sqr Mtrs	No Further Action Required
►S280	Management	Main, First, 123 Small Store, Walls Internal, Walls Internal		Num	No further action required
►S282	Management	Main, First, 124 Boys Toilets, Ceiling & Walls, Ceiling & Walls		Num	No further action required
►S284	Management	Main, First, 124 Boys Toilets, Toilet Seat, Toilet Seat	{As S230}	1 Num	No Further Action Required
►S286	Management	Main, Ground, 007 Gas Meter Cupboard , Walls & Floor, Walls & Floor		Num	No further action required
►S288	Management	Main, Ground, 008 Boiler Room , Walls & Floor, Walls & Floor		Num	No further action required
►S289	Management	Main, Ground, 008 Boiler Room , Pipework, Gaskets	S289	4 Num	No Further Action Required



► S290	Management	Main, Ground, 008 Boiler Room , Live Plant, Plant Equipment		Num	No further action required
► S292	Management	Main, Ground, 043 External Store, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S293	Management	Main, Ground, 047 Main Switch Room, Ceiling, Walls & Floor, Ceiling, Walls & Floor		Num	No further action required
► S294	Management	Main, Ground, 047 Main Switch Room, Electric Meter & Consumer Unit, Electric Meter & Consumer Unit		Num	No further action required
► S296	Management	Main, Ground, 049 Boiler Room 2, Ceiling, Ceiling	S296	15 Sqr Mtrs	No Further Action Required
► S298	Management	Main, Ground, 049 Boiler Room 2, Pipework, Gaskets	(As S289)	10 Num	No Further Action Required
► S299	Management	Main, Ground, 049 Boiler Room 2, Live Plant, Plant Equipment		Num	No further action required
► S300	Management	Main, Ground, 049 Boiler Room 2, Insulation Debris / Residues, All Surfaces	S300	40 Sqr Mtrs	No Further Action Required
► S303	Management	Main, External, All Elevations, Roof, Walls External & Rain Water Goods, Roof, Walls External & Rain Water Goods		Num	No further action required

Site Specific Areas of No Access [← Back](#)

The following areas were not accessed and need to be incorporated within the Management Plan and/or inspected during the re-inspection campaign, see Section 3 – Site Specific Information – Additional Notes for further information.

Record ID	Location	No Access Justification
<a href="#">▶ S002</a>	Main, Ground, 001 Main Entrance Lobby, Behind Cladding	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S007</a>	Main, Ground, 004 Corridor, Behind Cladding	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S035</a>	Main, Ground, 013 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S039</a>	Main, Ground, 014 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S042</a>	Main, Ground, 015 Classroom, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S046</a>	Main, Ground, 017 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S050</a>	Main, Ground, 018 Classroom, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
<a href="#">▶ S053</a>	Main, Ground, 019 Cloaks,	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.

	Below Floor Covering	
▶ S056	Main, Ground, 020 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S062	Main, Ground, 022 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S065	Main, Ground, 023 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S068	Main, Ground, 024 Classroom, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S072	Main, Ground, 027 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S076	Main, Ground, 028 Classroom, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S078	Main, Ground, 029 Female Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S084	Main, Ground, 031 Staff Room, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S089	Main, Ground, 032 Site Managers Room, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.



▶ S094	Main, Ground, 034 First Aid Room, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S098	Main, Ground, 035 Wet Room, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S101	Main, Ground, 076 Reprographics , Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S104	Main, Ground, 036 Junior Hall, Behind Cladding	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S109	Main, Ground, 037 Servery / Chair Store, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S117	Main, Ground, 052 Wash Up Area, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S121	Main, Ground, 039 & 040 Fire Exit , Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S122	Main, Ground, 041 Kitchen Office, Above Ceiling	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S126	Main, Ground, 045 Kitchen Toilet, Above Ceiling	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.

▶ S129	Main, Ground, 046 Changing Room, Above Ceiling	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S135	Main, Ground, 051 Classroom, Behind Boxing	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S140	Main, Ground, 053 Lobby 1, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S143	Main, Ground, 054 Resource Area, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S149	Main, Ground, 056 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S161	Main, Ground, 061 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S164	Main, Ground, 062 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S169	Main, Ground, 065 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S172	Main, Ground, 066 Resource Area, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.



▶ <a href="#">S175</a>	Main, Ground, 067 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S190</a>	Main, Ground, 072 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S206</a>	Main, Ground, N001 Cloakroom, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S209</a>	Main, Ground, N001A Disabled Toilet, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S212</a>	Main, Ground, N003 Store Room, No Access	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S219</a>	Main, Ground, N007 Laundry, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S222</a>	Main, Ground, N007A Laundry Store, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S227</a>	Main, First, 102 Lobby / Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S229</a>	Main, First, 103 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.



▶ S233	Main, First, 104 Resource Area , Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S236	Main, First, 105 Cleaners Store, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S249	Main, First, 110 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S251	Main, First, 111 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S255	Main, First, 112 & 113 Resource Area , Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S260	Main, First, 115 Lobby / Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S263	Main, First, 116 Resource Area , Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S265	Main, First, 117 Girls Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ S268	Main, First, 118 Cloaks, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.

▶ <a href="#">S281</a>	Main, First, 123 Small Store, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S283</a>	Main, First, 124 Boys Toilets, Below Floor Covering	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S291</a>	Main, Ground, 008 Boiler Room , Floor Void	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S301</a>	Main, External, All Elevations, Behind Fascias	Access was denied on the day of survey – see Inspection Comments (Material & Priority Assessment Records) for details.
▶ <a href="#">S302</a>	Main, External, Roof, No Access	A risk assessment identified high risk exposure to the surveyor, normally due to high voltage, height or other hazardous risks being present.